



Preliminary Information

PIT5869 SES MIL / AC Blows Warm Air / Fuse F4DR Open / DTC B1AA3 U3018 U3505


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021 - 2022	All	All	All	All
Chevrolet	Suburban	2021 - 2022	All	All	All	All
Chevrolet	Tahoe	2021 - 2022	All	All	All	All
GMC	Yukon Models	2021 - 2022	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment on the following symptoms: <ul style="list-style-type: none">- SES MIL- A/C blows warm air- DTC's B1AA3 U3018 U3505- Fuse F4DR open
Cause	The cause of these concerns could be circuit 4786, to the Front Floor Console Compartment Lamp, shorting out, opening the BCM 2 fuse F4DR.

Correction:

If a root cause is not found after following normal SI diagnostics, then gain access to the front floor console lid hinge area to inspect the wiring for the console compartment lamp, see below. In some cases, the two circuits to the compartment lamp will be broken and shorted together, as shown. Repair/Replace any damaged circuits following normal SI wiring repairs.

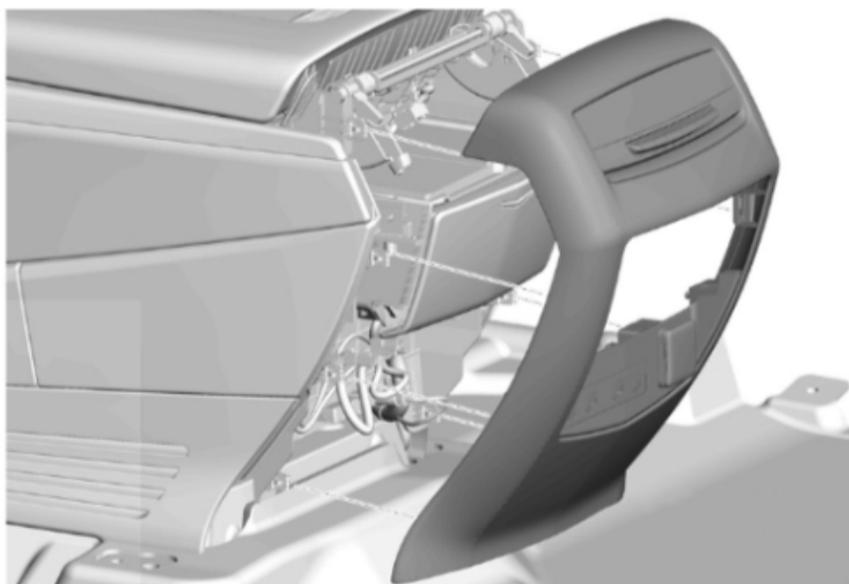



Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	11/29/2021 - Creatd on.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.